



24 March 2020

C0C3895

Paul Hughes

Eastex Environmental Laboratory - Nacogdoches


1119 South University Drive

Nacogdoches, TX 75961

RE: Nacogdoches WQP

Water Quality Parameters (WQP) Report

Enclosed, is your Water Quality Parameter (WQP) report with the necessary support data. Eastex Lab has reported your results to TCEQ in the following formats: 1. EDD of your data and 2. PDF of your report.

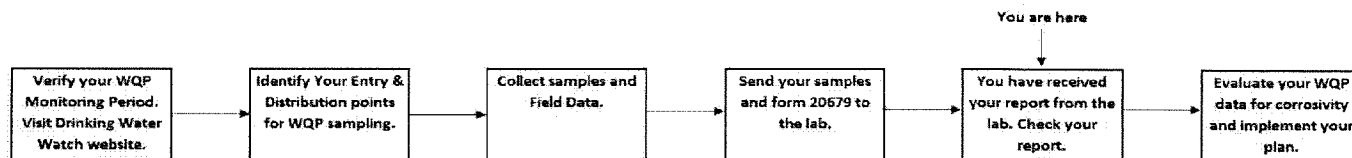

Here are your next actions:

1. Check your report for any errors, such as: Regulatory ID, site names. Please make sure all your sites are listed correctly.
2. Evaluate your WQP data for corrosivity and implement your plan.
3. Please retain all forms and reports from the lab for future field inspections.

If you have questions regarding any of the enclosed data, please call me at 936-653-3249. For compliance questions, please call TCEQ's WQP team at 512-239-4691.

Daniel Bowen

Operations Manager



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

Project: **Nacogdoches WQP**
Laboratory Sample ID: **C0C3895-01**
Sampling Point: **EWQP**
Sample Location: **N0C0670-01 (GW Plant CR 609)**
State Assigned ID: **PBCU001**

Sample Received Date and Time: 03/17/2020 13:10
Sample Date and Time: 03/10/2020 12:32
Sample Matrix: Potable
Sample Type: Grab
Collector: B Seth White

Analyte	Result	Units	Reporting Limits	MDL	Nelac Status	Batch	Analyzed	Analyst	Method	Notes
Eastex Environmental Laboratory - Coldspring										
Calcium, Total	<0.500	mg/L	0.500	0.0879	P	B0C2634	03/20/2020 10:27	LAN	EPA 200.7	
Chloride	9.6	mg/L	5.0	1.9	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	
Iron, Total	<0.150	mg/L	0.150	0.00255	A	B0C2624	03/19/2020 14:32	LAN	EPA 200.7	
Manganese, Total	<0.0100	mg/L	0.0100	0.00310	A	B0C2624	03/19/2020 14:32	LAN	EPA 200.7	
Sodium, Total	77.2	mg/L	0.500	0.111	A	B0C2634	03/20/2020 10:27	LAN	EPA 200.7	
Sulfate	17.5	mg/L	4.0	2.0	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

Project: **Nacogdoches WQP**
Laboratory Sample ID: **C0C3895-02**
Sampling Point: **EWQP**
Sample Location: **N0C0670-02 (11618 FM 225)**
State Assigned ID: **PBCU003**

Sample Received Date and Time: 03/17/2020 13:10
Sample Date and Time: 03/10/2020 11:20
Sample Matrix: Potable
Sample Type: Grab
Collector: B Seth White

Analyte	Result	Units	Reporting Limits	MDL	Nelac Status	Batch	Analyzed	Analyst	Method	Notes
Eastex Environmental Laboratory - Coldspring										
Calcium, Total	6.47	mg/L	0.500	0.0879	P	B0C2634	03/20/2020 10:29	LAN	EPA 200.7	
Chloride	11.9	mg/L	5.0	1.9	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	
Iron, Total	<0.150	mg/L	0.150	0.00255	A	B0C2624	03/19/2020 14:36	LAN	EPA 200.7	
Manganese, Total	<0.0100	mg/L	0.0100	0.00310	A	B0C2624	03/19/2020 14:36	LAN	EPA 200.7	
Sodium, Total	19.8	mg/L	0.500	0.111	A	B0C2634	03/20/2020 10:29	LAN	EPA 200.7	
Sulfate	40.5	mg/L	4.0	2.0	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

Project: **Nacogdoches WQP**
Laboratory Sample ID: **C0C3895-03**
Sampling Point: **DSTWQP**
Sample Location: **N0C0670-03 (1121 SE Stallings)**
State Assigned ID: **DS01**

Sample Received Date and Time: 03/17/2020 13:10
Sample Date and Time: 03/10/2020 12:50
Sample Matrix: Potable
Sample Type: Grab
Collector: B Seth White

Analyte	Result	Units	Reporting Limits	MDL	Nelac Status	Batch	Analyzed	Analyst	Method	Notes
Eastex Environmental Laboratory - Coldspring										
Calcium, Total	0.614	mg/L	0.500	0.0879	P	B0C2634	03/20/2020 10:39	LAN	EPA 200.7	
Chloride	11.7	mg/L	5.0	1.9	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	
Iron, Total	<0.150	mg/L	0.150	0.00255	A	B0C2624	03/19/2020 15:04	LAN	EPA 200.7	
Manganese, Total	<0.0100	mg/L	0.0100	0.00310	A	B0C2624	03/19/2020 15:04	LAN	EPA 200.7	
Sodium, Total	75.7	mg/L	0.500	0.111	A	B0C2634	03/20/2020 10:39	LAN	EPA 200.7	
Sulfate	17.5	mg/L	4.0	2.0	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

Project: **Nacogdoches WQP**
Laboratory Sample ID: **C0C3895-04**
Sampling Point: **DSTWQP**
Sample Location: **N0C0670-04 (734 Willow Oak)**
State Assigned ID: **DS01**

Sample Received Date and Time: 03/17/2020 13:10
Sample Date and Time: 03/10/2020 12:20
Sample Matrix: Potable
Sample Type: Grab
Collector: B Seth White

Analyte	Result	Units	Reporting Limits	MDL	Nelac Status	Batch	Analyzed	Analyst	Method	Notes
Eastex Environmental Laboratory - Coldspring										
Calcium, Total	0.624	mg/L	0.500	0.0879	P	B0C2634	03/20/2020 10:48	LAN	EPA 200.7	
Chloride	9.5	mg/L	5.0	1.9	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	
Iron, Total	<0.150	mg/L	0.150	0.00255	A	B0C2624	03/19/2020 15:23	LAN	EPA 200.7	
Manganese, Total	<0.0100	mg/L	0.0100	0.00310	A	B0C2624	03/19/2020 15:23	LAN	EPA 200.7	
Sodium, Total	78.5	mg/L	0.500	0.111	A	B0C2634	03/20/2020 10:48	LAN	EPA 200.7	
Sulfate	17.5	mg/L	4.0	2.0	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

Project: **Nacogdoches WQP**
Laboratory Sample ID: **C0C3895-05**
Sampling Point: **DSTWQP**
Sample Location: **N0C0670-05 (1902 Old Tyler)**
State Assigned ID: **DS01**

Sample Received Date and Time: 03/17/2020 13:10
Sample Date and Time: 03/10/2020 13:06
Sample Matrix: Potable
Sample Type: Grab
Collector: B Seth White

Analyte	Result	Units	Reporting Limits	MDL	Nelac Status	Batch	Analyzed	Analyst	Method	Notes
Eastex Environmental Laboratory - Coldspring										
Calcium, Total	6.57	mg/L	0.500	0.0879	P	B0C2634	03/20/2020 10:50	LAN	EPA 200.7	
Chloride	11.8	mg/L	5.0	1.9	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	
Iron, Total	<0.150	mg/L	0.150	0.00255	A	B0C2624	03/19/2020 15:28	LAN	EPA 200.7	
Manganese, Total	<0.0100	mg/L	0.0100	0.00310	A	B0C2624	03/19/2020 15:28	LAN	EPA 200.7	
Sodium, Total	19.9	mg/L	0.500	0.111	A	B0C2634	03/20/2020 10:50	LAN	EPA 200.7	
Sulfate	41.4	mg/L	4.0	2.0	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

Project: **Nacogdoches WQP**
Laboratory Sample ID: **C0C3895-06**
Sampling Point: **DSTWQP**
Sample Location: **N0C0670-06 (4925 US Hwy 59N)**
State Assigned ID: **DS01**

Sample Received Date and Time: 03/17/2020 13:10
Sample Date and Time: 03/10/2020 13:30
Sample Matrix: Potable
Sample Type: Grab
Collector: B Seth White

Analyte	Result	Units	Reporting Limits	MDL	Nelac Status	Batch	Analyzed	Analyst	Method	Notes
Eastex Environmental Laboratory - Coldspring										
Calcium, Total	7.96	mg/L	0.500	0.0879	P	B0C2634	03/20/2020 10:52	LAN	EPA 200.7	
Chloride	11.9	mg/L	5.0	1.9	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	
Iron, Total	<0.150	mg/L	0.150	0.00255	A	B0C2624	03/19/2020 15:33	LAN	EPA 200.7	
Manganese, Total	<0.0100	mg/L	0.0100	0.00310	A	B0C2624	03/19/2020 15:33	LAN	EPA 200.7	
Sodium, Total	20.1	mg/L	0.500	0.111	A	B0C2634	03/20/2020 10:52	LAN	EPA 200.7	
Sulfate	41.7	mg/L	4.0	2.0	A	B0C2270	03/18/2020 12:00	AMS	EPA 300.0	



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

EPA 300.0 - Quality Control

Eastex Environmental Laboratory - Coldspring

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------	-------

Batch B0C2270 - No Prep

Blank (B0C2270-BLK1)

Prepared & Analyzed: 03/18/20

Chloride	ND	5.0	mg/L							
Sulfate	ND	4.0	mg/L							

LCS (B0C2270-BS1)

Prepared & Analyzed: 03/18/20

Chloride	24.2		mg/L	25.0		96.8	90-110			
Sulfate	23.9		mg/L	25.0		95.7	90-110			

MRL Check (B0C2270-MRL1)

Prepared & Analyzed: 03/18/20

Chloride	5.24		mg/L	5.00		105	70-130			
Sulfate	4.54		mg/L	4.00		114	70-130			

Matrix Spike (B0C2270-MS1)

Source: C0C3895-01

Prepared & Analyzed: 03/18/20

Chloride	134	5.0	mg/L	125	9.64	99.8	80-120			
Sulfate	144	4.0	mg/L	125	17.5	101	80-120			

Matrix Spike Dup (B0C2270-MSD1)

Source: C0C3895-01

Prepared & Analyzed: 03/18/20

Chloride	134	5.0	mg/L	125	9.64	99.6	80-120	0.168	20	
Sulfate	144	4.0	mg/L	125	17.5	101	80-120	0.0737	20	

Batch B0C2624 - EPA 200.7

Blank (B0C2624-BLK1)

Prepared & Analyzed: 03/19/20

Iron, Total	ND	0.150	mg/L							
Manganese, Total	ND	0.0100	mg/L							

Blank (B0C2624-BLK2)

Prepared & Analyzed: 03/19/20

Iron, Total	ND	0.150	mg/L							
Manganese, Total	ND	0.0100	mg/L							



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

EPA 200.7 - Quality Control

Eastex Environmental Laboratory - Coldspring

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch B0C2624 - EPA 200.7										
Blank (B0C2624-BLK3)				Prepared & Analyzed: 03/19/20						
Iron, Total	ND	0.150	mg/L							
Manganese, Total	ND	0.0100	mg/L							
LCS (B0C2624-BS1)				Prepared & Analyzed: 03/19/20						
Iron, Total	0.252	0.150	mg/L	0.250		101	85-115			
Manganese, Total	0.246	0.0100	mg/L	0.250		98.5	85-115			
LCS (B0C2624-BS2)				Prepared & Analyzed: 03/19/20						
Iron, Total	0.256	0.150	mg/L	0.250		102	85-115			
Manganese, Total	0.248	0.0100	mg/L	0.250		99.1	85-115			
LCS (B0C2624-BS3)				Prepared & Analyzed: 03/19/20						
Iron, Total	0.251	0.150	mg/L	0.250		100	85-115			
Manganese, Total	0.246	0.0100	mg/L	0.250		98.5	85-115			
MRL Check (B0C2624-MRL1)				Prepared & Analyzed: 03/19/20						
Iron, Total	0.106		mg/L	0.150		70.7	70-130			
Manganese, Total	0.0124		mg/L	0.0100		124	70-130			
Matrix Spike (B0C2624-MS1)				Source: C0C2852-01	Prepared & Analyzed: 03/19/20					
Iron, Total	0.283	0.150	mg/L	0.250	0.0206	105	70-130			
Manganese, Total	0.265	0.0100	mg/L	0.250	0.0148	100	70-130			
Matrix Spike (B0C2624-MS2)				Source: C0C3895-03	Prepared & Analyzed: 03/19/20					
Iron, Total	0.295	0.150	mg/L	0.250	0.0404	102	70-130			
Manganese, Total	0.255	0.0100	mg/L	0.250	ND	102	70-130			
Matrix Spike (B0C2624-MS3)				Source: C0C3900-01	Prepared & Analyzed: 03/19/20					
Iron, Total	0.457	0.150	mg/L	0.250	0.186	108	70-130			
Manganese, Total	0.578	0.0100	mg/L	0.250	0.308	108	70-130			



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

EPA 200.7 - Quality Control

Eastex Environmental Laboratory - Coldspring

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------	-------

Batch B0C2624 - EPA 200.7

Matrix Spike Dup (B0C2624-MSD1)

Source: C0C2852-01

Prepared & Analyzed: 03/19/20

Iron, Total	0.278	0.150	mg/L	0.250	0.0206	103	70-130	1.94	20	
Manganese, Total	0.263	0.0100	mg/L	0.250	0.0148	99.1	70-130	1.04	20	

Matrix Spike Dup (B0C2624-MSD2)

Source: C0C3895-03

Prepared & Analyzed: 03/19/20

Iron, Total	0.303	0.150	mg/L	0.250	0.0404	105	70-130	2.69	20	
Manganese, Total	0.254	0.0100	mg/L	0.250	ND	102	70-130	0.173	20	

Matrix Spike Dup (B0C2624-MSD3)

Source: C0C3900-01

Prepared & Analyzed: 03/19/20

Iron, Total	0.451	0.150	mg/L	0.250	0.186	106	70-130	1.28	20	
Manganese, Total	0.563	0.0100	mg/L	0.250	0.308	102	70-130	2.56	20	

Batch B0C2634 - EPA 200.7

Blank (B0C2634-BLK1)

Prepared: 03/19/20 Analyzed: 03/20/20

Calcium, Total	ND	0.500	mg/L							
Sodium, Total	ND	0.500	mg/L							

Blank (B0C2634-BLK2)

Prepared: 03/19/20 Analyzed: 03/20/20

Calcium, Total	ND	0.500	mg/L							
Sodium, Total	ND	0.500	mg/L							

Blank (B0C2634-BLK3)

Prepared: 03/19/20 Analyzed: 03/20/20

Calcium, Total	ND	0.500	mg/L							
Sodium, Total	ND	0.500	mg/L							

LCS (B0C2634-BS1)

Prepared: 03/19/20 Analyzed: 03/20/20

Calcium, Total	25.1	0.500	mg/L	25.0		100	85-115			
Sodium, Total	26.7	0.500	mg/L	25.0		107	85-115			



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

EPA 200.7 - Quality Control

Eastex Environmental Laboratory - Coldspring

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch B0C2634 - EPA 200.7										
LCS (B0C2634-BS2)				Prepared: 03/19/20 Analyzed: 03/20/20						
Calcium, Total	25.4	0.500	mg/L	25.0		102	85-115			
Sodium, Total	27.3	0.500	mg/L	25.0		109	85-115			
LCS (B0C2634-BS3)				Prepared: 03/19/20 Analyzed: 03/20/20						
Calcium, Total	26.0	0.500	mg/L	25.0		104	85-115			
Sodium, Total	28.2	0.500	mg/L	25.0		113	85-115			
MRL Check (B0C2634-MRL1)				Prepared: 03/19/20 Analyzed: 03/20/20						
Calcium, Total	0.515		mg/L	0.500		103	70-130			
Sodium, Total	0.510		mg/L	0.500		102	70-130			
Matrix Spike (B0C2634-MS1)				Source: C0C2852-01	Prepared: 03/19/20 Analyzed: 03/20/20					
Calcium, Total	94.7	0.500	mg/L	25.0	67.5	109	70-130			
Sodium, Total	65.4	0.500	mg/L	25.0	38.1	109	70-130			
Matrix Spike (B0C2634-MS2)				Source: C0C3895-03	Prepared: 03/19/20 Analyzed: 03/20/20					
Calcium, Total	26.6	0.500	mg/L	25.0	0.614	104	70-130			
Sodium, Total	102	0.500	mg/L	25.0	75.7	106	70-130			
Matrix Spike (B0C2634-MS3)				Source: C0C3900-01	Prepared: 03/19/20 Analyzed: 03/20/20					
Calcium, Total	37.4	0.500	mg/L	25.0	12.0	102	70-130			
Sodium, Total	142	0.500	mg/L	25.0	123	73.0	70-130			
Matrix Spike Dup (B0C2634-MSD1)				Source: C0C2852-01	Prepared: 03/19/20 Analyzed: 03/20/20					
Calcium, Total	94.8	0.500	mg/L	25.0	67.5	109	70-130	0.0252	20	
Sodium, Total	65.7	0.500	mg/L	25.0	38.1	110	70-130	0.359	20	
Matrix Spike Dup (B0C2634-MSD2)				Source: C0C3895-03	Prepared: 03/19/20 Analyzed: 03/20/20					
Calcium, Total	26.7	0.500	mg/L	25.0	0.614	104	70-130	0.204	20	
Sodium, Total	102	0.500	mg/L	25.0	75.7	104	70-130	0.437	20	



P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

EPA 200.7 - Quality Control

Eastex Environmental Laboratory - Coldspring

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	--------------------	-------	----------------	------------------	------	----------------	-----	--------------	-------

Batch B0C2634 - EPA 200.7

Matrix Spike Dup (B0C2634-MSD3)

Source: C0C3900-01

Prepared: 03/19/20 Analyzed: 03/20/20

Calcium, Total	37.2	0.500	mg/L	25.0	12.0	101	70-130	0.579	20	
Sodium, Total	143	0.500	mg/L	25.0	123	77.8	70-130	0.838	20	



Eastex Environmental Laboratory - Nacogdoches
1119 South University Drive
Nacogdoches TX, 75961

P.O. Box 1089 Coldspring Tx 77331
Website: eastexlabs.com
Email: eastexlab@eastex.net
Tel: 936 653 3249



TCEQ Report ID: **PWS_TX1740003_AC_20200310_WQP Analysis Report**

Qualifiers and Notes



TEXAS COMMISSION ON ENVIRONMENTAL QUALITY
WATER QUALITY PARAMETER MONITORING FORM 20679

P05.114003-PC-00200310-00AP

Completed by PWS (or Agent)

Completed by Laboratory

PWS Name: City of Nacogdoches

Laboratory Name:

Eastex Environmental Lab

PWS ID #: TX1740003

TCEQ Lab ID #:

TX00962

PWS Address: P.O. Box 635030, Nacogdoches, TX 75963-5030

Laboratory Address:

P.O. Box 631375
Nacogdoches, TX 75963

PWS Contact: Bart Allen

PWS Contact Phone #: 936-564-5046 EXT: 2585

Laboratory Contact:

Paul D. Hughes

Inhibitor or Stabilizer Used (Y):

Phosphate

Silica

Calcium carbonate

TREATMENT

Alkalinity Dosage Rate: N/A

Inhibitor Dosage Rate: N/A

Laboratory Contact Phone #:

936 569-8879

Sample Type (Y): ☒ Compliance

Non-compliance

Sample Collector (Y): ☒ Public Water System

Accredited Lab

3rd Party Contractor --> LAB ID

AL

Temperature and pH (Y or N): ☒ Are temperature and pH included on the sampling entity's Laboratory Approval Form on file at the TCEQ?

Y

Were temperature and pH measured in the field within 15 minutes of sample collection?

Parameters Requested: Analyses are required for the parameters checked. * If inhibitors containing phosphate or silica are used, then these parameters should also be analyzed depending on which is in use.

Facility ID (e.g. DS01, PBCU001)	Sample Point ID (e.g. DSTWQP, EWQP)	Sample Location	Sample Collection		Field Measurements		Replacement? (Y/N)	Original Sample ID #	Original Sample Date (MMDDYY)	Lab Sample ID	Alkalinity (1927)	Calcium (1919)	Chloride (1017)	Conductivity (1064)	Hardness (1915)	Iron (1028)	Manganese (1032)	Sodium (1052)	Sulfate (1055)	TDS (1930)	O-Phosphate (1044) *	Silica (1049) *
			Date (MMDDYY)	Time - 24 hr (HHMM)	pH	Temp (°C)																
PBCU001	EWQP	GW Plant - CR 609	03/02/20	1232	7.63	23.1				N0C0670-01	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
PBCU003	EWQP	11618 FM 225	03/02/20	1120	9.23	17.8				N0C0670-02	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
DS01	DSTWQP	1121 S.E. Stallings	03/02/20	1250	7.67	21.8				N0C0670-03	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
DS01	DSTWQP	734 Willow Oak	03/02/20	1220	7.66	21.6				N0C0670-04	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
DS01	DSTWQP	1902 Old Tyler	03/02/20	1306	9.10	17.5				N0C0670-05	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
DS01	DSTWQP	4925 US Hwy. 59N	03/02/20	1230	9.29	17.4				N0C0670-06	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		

I acknowledge that information on this form is true and correct and sites selected for sampling follow the instructions in the TCEQ Monitoring and Sample Collection Guidance for Water Quality Parameters. This includes, but not limited to the measurement of pH and temperature immediately upon collection. Falsification of this form or tampering with water samples is a crime punishable under state and/or federal law. (Texas Penal Code, Title 8, Chapter 37.10)

Name of Authorized PWS Representative (Print)

Signature

Organization

Date

B. Seth White

City of Nacogdoches

03/02/20

Chain of Custody

Date/Time:

3-10-20/1345

Relinquished by Courier (Signature)

Date/Time:

Received by Courier (Signature)

Date/Time:

Received by Lab (Signature)

Date/Time:

Rejection Code (if applicable):
Date & Time of Sample Preservation (acidified):
Thermometer ID #:
Laboratory Comments:

Y Samples received unpreserved?

Y

Actual / Corrected sample temperature:

3.9°C

017



TEXAS COMMISSION ON ENVIRONMENTAL QUALITY
WATER QUALITY PARAMETER MONITORING FORM 20679

PWS 174003-PC-0000310-WAP

Completed by PWS (or Agent)

Completed by Laboratory

PWS Name:		Refer to Original WAP MF				Laboratory Name:		Easter Environmental Lab	
PWS ID#:		TX174003, City of Macosdosas, NCC0670)				TCEQ Lab ID #:		TX203	
PWS Address:						Laboratory Address:		PO Box 1089	
PWS Contact:						Laboratory Contact:		Coldspring, TX 77331	
PWS Contact Phone #:						Laboratory Contact Phone #:		Natalia Bondar	
Inhibitor/Stabilizer Used (Y)		Phosphate		Silica		Calcium carbonate		(936) 653-3249	
TREATMENT		Alkalinity Dosage Rate		Inhibitor Dosage Rate		Laboratory Contact Phone #			
Sample Type (Y)		Compliance		Non-Compliance		Sample Information			
Sample Collector (Y)		Public Water System		Accredited Lab		3rd Party Contractor -> Lab ID		AL	
Temperature and pH (N or Y)		Are temperature and pH included on the sampling party's Laboratory Approval Form on file at the TCEQ?		Were temperature and pH measured in the field within 15 minutes of sample collection?		Field Measurements			
Facility ID (e.g. DS01, RB0001)		Sample Location		Sample Collection		Field Measurements			
Sample Point ID (e.g. DSTM09, EM09)		Date (MMDDYY)		Time - 24 hr (HHMM)		pH		Temp (°C)	
PWS001		031020		1232					
PWS002		031020		1120					
PWS003		031020		1250					
PWS004		031020		1220					
PWS005		031020		1306					
PWS006		031020		1330					
PWS007		031020		1330					
PWS008		031020		1330					
PWS009		031020		1330					
PWS010		031020		1330					
PWS011		031020		1330					
PWS012		031020		1330					
PWS013		031020		1330					
PWS014		031020		1330					
PWS015		031020		1330					
PWS016		031020		1330					
PWS017		031020		1330					
PWS018		031020		1330					
PWS019		031020		1330					
PWS020		031020		1330					
PWS021		031020		1330					
PWS022		031020		1330					
PWS023		031020		1330					
PWS024		031020		1330					
PWS025		031020		1330					
PWS026		031020		1330					
PWS027		031020		1330					
PWS028		031020		1330					
PWS029		031020		1330					
PWS030		031020		1330					
PWS031		031020		1330					
PWS032		031020		1330					
PWS033		031020		1330					
PWS034		031020		1330					
PWS035		031020		1330					
PWS036		031020		1330					
PWS037		031020		1330					
PWS038		031020		1330					
PWS039		031020		1330					
PWS040		031020		1330					
PWS041		031020		1330					
PWS042		031020		1330					
PWS043		031020		1330					
PWS044		031020		1330					
PWS045		031020		1330					
PWS046		031020		1330					
PWS047		031020		1330					
PWS048		031020		1330					
PWS049		031020		1330					
PWS050		031020		1330					
PWS051		031020		1330					
PWS052		031020		1330					
PWS053		031020		1330					
PWS054		031020		1330					
PWS055		031020		1330					
PWS056		031020		1330					
PWS057		031020		1330					
PWS058		031020		1330					
PWS059		031020		1330					
PWS060		031020		1330					
PWS061		031020		1330					
PWS062		031020		1330					
PWS063		031020		1330					
PWS064		031020		1330					
PWS065		031020		1330					
PWS066		031020		1330					
PWS067		031020		1330					
PWS068		031020		1330					
PWS069		031020		1330					
PWS070		031020		1330					
PWS071		031020		1330					
PWS072		031020		1330					
PWS073		031020		1330					
PWS074		031020		1330					
PWS075		031020		1330					
PWS076		031020		1330					
PWS077		031020		1330					
PWS078		031020		1330					
PWS079		031020		1330					
PWS080		031020		1330					
PWS081		031020		1330					
PWS082		031020		1330					
PWS083		031020		1330					
PWS084		031020		1330					
PWS085		031020		1330					
PWS086		031020		1330					
PWS087		031020		1330					
PWS088		031020		1330					
PWS089		031020		1330					
PWS090		031020		1330					
PWS091		031020		1330					
PWS092		031020		1330					
PWS093		031020		1330					
PWS094		031020		1330					
PWS095		031020		1330					
PWS096		031020		1330					
PWS097		031020		1330					
PWS098		031020		1330					
PWS099		031020		1330					
PWS100		031020		1330					
PWS101		031020		1330					
PWS102		031020		1330					
PWS103		031020		1330					
PWS104		031020		1330					
PWS105		031020		1330					
PWS106		031020		1330					
PWS107		031020		1330					
PWS108		031020		1330					
PWS109		031020		1330					
PWS110		031020		1330					
PWS111		031020		1330					
PWS112		031020		1330					
PWS113		031020		1330					
PWS114		031020		1330					
PWS115		031020		1330					
PWS116		031020		1330					
PWS117		031020		1330					
PWS118		031020		1330					
PWS119		031020		1330					
PWS120		031020		1330					
PWS121		031020		1330					
PWS122		031020		1330					
PWS123		031020		1330					
PWS124		031020		1330					
PWS125		031020		1330					
PWS126		031020		1330					
PWS127		031020		1330					
PWS128		031020		1330					
PWS129		031020		1330					
PWS130		031020		1330					
PWS131		031020		1330					
PWS132		031020		1330					
PWS133		031020		1330					
PWS134		031020		1330					
PWS135		031020		1330					
PWS136		031020		1330					
PWS137		031020		1330					
PWS138		031020		1330					
PWS139		031020		1330					
PWS140		031020		1330					
PWS141		031020		1330					
PWS142		031020		1330					
PWS143		031020		1330					
PWS144		031020		1330					
PWS145		031020		1330					
PWS146		031020		1330					
PWS147		031020		1330					
PWS148		031020		1330					
PWS149		031020		1330					
PWS150		031020		1330					
PWS151		031020		1330					
PWS152		031020		1330					
PWS153		031020		1330					
PWS154		031020		1330					
PWS155		031020		1330					
PWS156		031020		1330					
PWS157		031020		1330					
PWS158		031020		1330					
PWS159		031020		1330					
PWS160		031020		1330					
PWS161		031020		1330					
PWS162		031020		1330					
PWS163		031020		1330					
PWS164		031020		1330					
PWS165		031020		1330					
PWS166		031020		1330					
PWS167		031020		1330					
PWS168		031020		1330					
PWS169		031020		1330					
PWS170		031020		1330					
PWS171		031020		1330					
PWS172		031020		1330					
PWS173		031020		1330					
PWS174		031020		1330					
PWS175		031020		1330					
PWS176		031020		1330					
PWS177		031020		1330					
PWS178		031020		1330					
PWS179		031020		1330					
PWS180		031020		1330					
PWS181		031020		1330					
PWS182		031020		1330					
PWS183		031020		1330					
PWS184		031020		1330					
PWS185		031020		1330					
PWS186		031020		1330					
PWS187		031020		1330					
PWS188		031020		1330					
PWS189		031020		1330					
PWS190		031020		1330					
PWS191		031020		1330					
PWS192		031020		1330					
PWS193		031020		1330					
PWS194		031020		1330					
PWS195		031020		1330					
PWS196		031020		1330					
PWS197		031020		1330					
PWS198		031020		1330					
PWS199		031020		1330					
PWS200		03102							