

WM MR_Rio Grande_RP_20230126_Monthly Report-jpena
Texas Commission on Environmental Quality
Investigation Report

The TCEQ is committed to accessibility. If you need assistance in accessing this document, please contact oce@tceq.texas.gov

**Customer: RGWM INSP LOWER REACH I FALCON DAM TO
RIO GRANDE CITY BRIDGE**
Customer Number: CN604933788

**Regulated Entity Name: RGWM-INSP-LOWER REACH I- FALCON DAM- RIO
GRANDE CITY BRIDGE**

Regulated Entity Number: RN106122419

Investigation # 1873739

Investigator: JUAN PENA

Conducted: 01/03/2023 -- 01/25/2023

Program(s): WATER RIGHTS

Investigation Type: Compliance Investigation

Incident Numbers

Site Classification CERTIFICATE OF
ADJUDICATION

No Industry Code Assigned

Location:

RN102641560,RN105025456,RN102632239,RN10262
2917,RN102819083,
RN103130670,RN103137543,RN101460574,RN103900
395,RN103195798,
RN103898334,RN102819869,RN101472397,RN102971
553,RN102626793,
RN101470409,RN102073962,RN102631082,RN10262
2461,RN102631082, RN101472405,

Additional ID(s):

Address: ,

, ,

Local Unit: REGION 15 - HARLINGEN

Activity Type(s): WMDIVER - WM Diversion Site
Investigation - Rio Grande Only

Principal(s):

Role

Name

RESPONDENT
RESPONDENT
RESPONDENT
RESPONDENT

RGWM INSP LOWER REACH II RIO GRANDE CITY BRID
RRGWM GWM INSP LOWER REACH III ANZALDUAS DA
RGWM INSP LOWER REACH VI CC6 LOS TOMATES INT
RGWM INSP LOWER REACH I FALCON DAM TO RIO GR

Contact(s):

Role

Title

Name

Phone

Other Staff Member(s):

Role

Name

QA Reviewer
Supervisor

GEORGINA BERMEA
GEORGINA BERMEA

Associated Check List**Checklist Name**RIO GRANDE WATERMASTER INSPECTION
CHECKLIST**Unit Name**

RGWM-CHK

Investigation Comments:

CCEDS INVESTIGATION No. 1873739

INTRODUCTION

Watermaster Specialist, Juan Peña of the Texas Commission on Environmental Quality (TCEQ), Rio Grande Watermaster Program, conducted water right site investigations and monitored surface water use along the Rio Grande River and its tributaries. These field investigations were conducted during the period of January 3, 2023 through January 25, 2023 ; and included water right holders /diverters within the following reaches of the Rio Grande.

Lower Rio Grande Reaches (LR) have been broken down as follows:

LR I between the Falcon Dam to Rio Grande City International Bridge
RN106122419
LR II between the Rio Grande City International Bridge to the Anzalduas Dam
RN106122450
LR III between the Anzalduas Dam to the Progreso International Bridge
RN106122468
LR IV between the Progreso International Bridge to Francis Phillips site
RN106122484
LR V between the Francis Phillips site to Teofilo Flores T283
RN 106122492
LRVI between the Teofilo Flores T283 to Los Tomates International Bridge
RN 106122526
LRVII between Los Tomates International Bridge to the Gulf of Mexico
RN 106122674

Lower Rio Grande Floodway areas (FW) have been broken down as follows:

FW I Cameron County RN106122849
FW II Hidalgo County RN106122856
FW V Main Floodway North Levee RN106122880
FW VI Main Floodway South Levee RN106122898

GENERAL ENTITY AND PROCESS INFORMATION

The following entities referred to in this investigation were surveyed and/or monitored during the field investigations. The entities are described by the following standard industrial classification (SIC) codes: 721 for crop planting, cultivating, and/or protecting, 1381 for oil and gas exploration activities, and/or 4941 for water supply entities.

A detailed description of each regulated entity with its associated water right account information can be found in the TCEQ Rio Grande Watermaster files, including specific SIC codes and associated water right information.

Water right accounts and or diverters in the following reaches or segments:

LR I Falcon Dam to Rio Grande City International Bridge
LR II Rio Grande City International Bridge to the Anzalduas Dam
LR III Anzalduas Dam to the Progreso International Bridge
LR IV Progreso International Bridge to Francis Phillips site
LR V Francis Phillips site to Teofilo Flores T283
LRVI Teofilo Flores T283 to Los Tomates International Bridge
LRVII Los Tomates International Bridge to the Gulf of Mexico
FW I Cameron County
FW II Hidalgo County

BACKGROUND

The TCEQ Rio Grande Watermaster Program routinely conducts investigations along the Rio Grande River and/or its Tributaries to ensure compliance with applicable State rules and regulations related to the watermaster program and to the diversion and use of State waters.

ADDITIONAL INFORMATION:

During the course of these investigations, the Watermaster Specialist performed watermaster-related activities that may have included but were not limited to the following:

857	Inspections
102	Measurements
13	Doppler Checks
1	On-Site Notices

Please refer to the attached investigation notes (Attachment A: Deputy's Daily Report) for the specific observations of these investigation sites.

No Violations Associated to this Investigation


Signed



Environmental Investigator

Date 01/31/2023

Signed

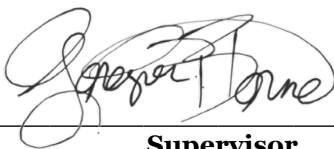

Supervisor

Date 01/31/2023

Attachments: (in order of final report submittal)

___ Enforcement Action Request (EAR)

___ Letter to Facility (specify type) : _____

Investigation Report

___ Sample Analysis Results

___ Manifests

___ Notice of Registration

___ Maps, Plans, Sketches

___ Photographs

___ Correspondence from the facility

___X___ Other (specify) :

___ Attachment A; Deputy 's Daily Reports ___

List of Attached files

Attachment A_January_Juan Pena.docx

**TEXAS COMMISSION ON ENVIRONMENTAL
QUALITY**



ATTACHMENT A

Regulated Entity No.		106122419 106122450 106122468 106122526	Regulated Entity	Reaches I, II, III, VI	County Name	Cameron Hidalgo Starr
Investigation Date	January 3, 2023 - January 25 22, 2023	TCEQ Investigator(s):		Juan Peña		

Deputy's Daily Report

1/3/2023, 1/4/2023, 1/5/2023, 1/9/2023, 1/11/2023, 1/12/2023, 1/13/2023,
1/17/2023, 1/18/2023, 1/19/2023, 1/23/2023, 1/25/2023



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/3/2023	Inspections:	85
Time Start:	8:20 AM	Measurement:	12
Time End:	4:15 PM	Doppler:	0
Inspec Time:	5.75 Hrs.	On-Site Notice:	0
RN#:	106122450	Travel Time:	2 Hrs.

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:26	0802-000	HCID #16	1	0	0		14971.76			X			
			2		0		16475.14			X			
9:42	0828-001	HCID #6	1	13	14					X			
			2				38873.58			X	X		
			3				10178.24			X			
			4				5080.21			X			
10:05	0816-002	HCID #1	1	45	40		13800.5578			X			
			2							X			
			4							X	X		
			5							X			
			6							X			
10:26	A847-001	United ID	1	100	0		84391.28			X			
			2		94		10930.3			X	X		
			3		0		10248.4			X			
10:51	0832-000	HCWC & ID #18	10M112-9	0	0		596182			X			
			10M112-8		0		95.102			X			
11:08	0806-000	HCWC & ID # 19	1	0	0		13585.7			X			
			2		0		7700.4			X			
			3		0		15338.8			X			
11:35	0848-002	HCWID #3	1	0	0		8858.702			X			
			2		0		349.01			X			
			3		0		6674.74			X			
			4		0		61513.5			X			
			5							X			
			6							X			

Comments: Rotation 4 - Irrigation Districts

Page 1 of 4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
11:35	0848-002	HCWID #3	7	0	0		61513.5			X			
			Neuhaus	0	0		2108.19			X			
12:10	0808-005	HCID # 2	1	110	0		2433.767			X			
			2		0		8516.297			X			
			3		0		9248.324			X			
			4		57		39555.449			X	X		
			5		0		3062.357			X			
			6		53		5525.7			X	X		
			7		0		33393.601			X			
			8		0		1553.139			X			
			9		0		25304.951			X			
			10		0		15887.386			X			
13:08	0805-003	Donna ID	1	40	0		592.049			X			
			2		0		0			X			
			3		41		21.5			X	X		
			4		0		OFF			X			
			5		0		0			X			
13:30	0813-000	HCID #5	1	20	0		4449.99			X			
			2		18		1400.79			X	X		
			3		0		1745.6			X			
			4		0		2839.68			X			
13:50	0812-007	H & CCID #9	1	60	0		40072060			X			
			2		0		18003.514			X			
			3		0		6674.74			X			
			4		0		13326.127			X			

Comments:

Lunch 12:25 - 12:50

Page

2

of

4

Specialist Signature

Juan Peña



**Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report**

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
13:50	0812-007	H & CCID #9	5	60	0		14169.91			X			
			6		0		852786.628			X			
			7		53		41124.513			X	X		
			8		0		35684.734			X			
			9		0		2062.913			X			
			10		0		1135.147			X			
14:07	0811-002	Delt Lake ID	1	0	0		Meter Off			X			
			2							X			
			3							X			
			4							X			
14:27	0803-005	La Feria ID (Santa Maria)	1	17	0		2461.47			X			
			2		15		6329.04			X	X		
			3		0		3458.84			X			
14:36	0803-005	La Feria ID	1	45	0		51338.9			X			
			2		50		7216.7			X	X		
			3							X			
			4		0		102990.7			X			
			5							X			
14:46		Harlingen ID (Adams)	1	0	0		49577.5			X			
			2							X			
15:00	0831-003	Harlingen ID	1	50	0		567.61			X			
			2		0		Error			X			
			3		48		3231.3			X	X		
			4		0		1305.7			X			
			5		0		726.2			X			

Comments: Harlingen ID - pump 2 error with totalizer reading. Talked to employee, he said it has been scheduled for repair.

Page 3 of 4

Specialist Signature

Juan Peña

**Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report**



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/4/2023	Inspections:	96
Time Start:	8:14 AM	Measurement:	11
Time End:	4:20 PM	Doppler:	0
Inspec Time:	6 Hrs.	On-Site Notice:	0
RN#:	106122526	Travel Time:	2 Hrs.

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:00		Brownsville Gaging Station							1.4	X			
9:10	A843-000	Brownsville ID	1	0	0		5818			X			
			2				No Meter			X			
			3				No Meter			X			
9:40	0010-002	Edward Mathers Farms	Ghost T297							X			
9:41			Ghost T297							X			
9:43			Ghost T297							X			
9:45			Ghost T297							X			
9:48	M865-000	Brownsville PUB	1	30	20		21618			X	X		
			2		0		2076			X			
			3							X			
10:12	0829-000	CCID #6	1	0	0		29005830			X			
			2							X			
			3							X			
			4							X			
			6							X			
			7							X			
10:24	0072-002	VMUD #2	1	0	0		0.0005			X			
			2		0		107.165			X			
			3		0		2067.9494			X			
10:48	0167-000	Victoria Farms	Ghost T275							X			
10:51	0288-000	Russell Plantation	1	0			No Meter			X			
			2							X			
10:52	0295-000	Teofilo Flores	Ghost T274							X			
11:07	0850-000	Laguna Madre WD	1	21	0		664094854						

Comments:	Rotation 4 - Irrigation Districts	Page	1	of	4	Specialist Signature	



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
11:07	0850-000	Laguna Madre WD	2	21	0		224035			X			
			3		20		590136			X	X		
11:22	0838-002	CCID #2 (Paloma)	1	0	0		21662.018			X			
			2		0		966.179			X			
			3		0		0			X			
11:39	0841-005	CCID # 2	1	50	0		24709.68			X			
			2							X			
			3							X			
			4							X			
			5		50		189.47			X			
			6							X	X		
			7							X			
			8							X			
11:48	0831-003	Harlingen ID	1	50	0		567.6			X			
			2		0		Error			X			
			3		0		3318.7			X			
			4		47		1306.1			X	X		
			5		0		726.2			X			
			6		0		969.5			X			
			7		0					X			
11:59		Harlingen ID (Adams)	1	0	0		49577.5			X			
			2							X			
12:11	0803-005	La Feria ID	1	45	0		51338.9			X			
			2		0		7216.7			X			
			3							X			

Comments:

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code	
								SB	BR					
12:11	0803-005	La Feria ID	4	45	47		103077			X	X			
			5						X					
12:19		La Feria ID (Santa Maria)	1	0	0		3458.84			X				
			2		0		6331.8			X				
			3		0		2461.47			X				
12:38	0811-002	Delta Lake ID	1	100	104		82645.519			X				
			2							X	X			
			3							X				
			4							X				
12:52	0812-007	H & CCID #9	1	60	0		40072060.95			X				
			2		0		18003.514			X				
			3		0		68591.68			X				
			4		0		13326.127			X				
			5		0		14169.91			X				
			6		0		852786.632			X				
			7		63		41224.433			X	X			
			8		0		35684.734			X				
			9		0		2062.913			X				
			10		0		1135.147			X				
13:50	0813-000	HCID # 5	1	0	0		4449.99			X				
			2		0		1429.83			X				
			3		0		1745.6			X				
			4		0		2839.68			X				
14:11	0805-003	Donna ID	1	40	0		592.049			X				
			2		0		0			X				

Comments:

Lunch 1:00 - 1:30

Page

3

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
14:11	0805-000	Donna ID	3	40	39		101.1			X	X		
			4		0		OFF			X			
			5		0		0			X			
14:40	0808-005	HCID #2	1	110	0		2433.767			X			
			2		0		8516.297			X			
			3		0		9248.324			X			
			4		55		39681.912			X	X		
			5		0		3062.359			X			
			6		50		5640.736			X	X		
			7		0		33393.601			X			
			8		0		1553.139			X			
			9		0		25304.951			X			
			10		0		15887.386			X			
15:10	0848-002	HCWID #3	1	0			8858.702			X			
			2				3490.01			X			
			3				6674.74			X			
			4				61513.5			X			
			5							X			
			6							X			
			7							X			
			Neuhaus		3		2113.4			X	X		

Comments:

HCWID #3 - all pumps were off.

Page

4

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/5/2023	Inspections:	91
Time Start:	8:14 AM	Measurement:	12
Time End:	4:10 PM	Doppler:	0
Inspec Time:	5.75	On-Site Notice:	0
RN#:	106122450	Travel Time:	2 Hrs.

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:10	0828-001	HCID #6	1	13						X			
			2		0		38873.58			X			
			3		0		10215.21			X			
			4		17		5081.15			X	X		
9:40	0816-001	HCID #1	1	45	41		13670.6025			X			
			2							X			
			3							X	X		
			4							X			
			5							X			
			6							X			
10:04	A847-001	United ID	1	100	0		84391.28			X			
			2		0		11178.83			X			
			3		0		10248.4			X			
10:28	0832-000	HCWC & ID #18	10M112-9				596182			X			
			10M112-8				95.102			X			
10:43	0806-000	HCWC & ID#19	1	0	0		13585.7			X			
			2		0		7700.4			X			
			3		0		15338.8			X			
			4		0		3217.9			X			
11:05	0848-002	HCID #3	1	0	0		8858.702			X			
			2		0		349.01			X			
			3		0		6674.74			X			
			4		0		6151.35			X			
			5							X			
			6							X			

Comments:

Rotation 4 - Irrigation Districts. HCID #6 - Called Rafael on flow rate. He contacted ID. United ID had stopped pumping. Called Raymond with United and Rafael.

Page

1

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
11:05	0848-002	HCID #3	7	0	0		6151.35			X			
			Neuhaus		4		2115.87			X	X		
11:27	0808-005	HCID #2	1	110	0		2433.767			X			
			2		0		8516.297			X			
			3		0		9248.324			X			
			4		57		39780.647			X	X		
			5		0		3062.359			X			
			6		51		5730.192			X	X		
			7		0		33393.601			X			
			8		0		1553.139			X			
			9		0		25304.951			X			
			10		0		15887.386			X			
11:57	0805-003	Donna ID	1	40	0		592.049			X			
			2		0		0			X			
			3		43		170.6			X	X		
			4		0		OFF			X			
			5		0		0			X			
12:21	0813-000	HCID #5	1	0			4449.99			X			
			2				1429.83			X			
			3				1745.6			X			
			4				2839.69			X			
13:07	0812-007	H & CCID #9	1	60	0		4002060.948			X			
			2		0		18003.514			X			
			3		0		68591.681			X			
			4		0		13326.127			X			

Comments:

HCID #3 all pumps are off. Lunch 12:25 - 12:50

Page

2

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
13:07	0812-007	H & CCID #9	5	60	0		14169.91			X			
			6		0		852786.637			X			
			7		62		41352.776			X	X		
			8		0		35684.734			X			
			9		0		2062.913			X			
			10		0		1135.147			X			
13:23	0811-002	Delta Lake ID	1	100	107		82859.396			X			
			2							X	X		
			3							X			
			4							X			
13:41	0803-005	La Feria ID (Santa Maria)	1	0	0		3458.84			X			
			2		0		6331.8			X			
			3		0		2461.47			X			
13:47		La Feria ID	1	45	0		51338.9			X			
			2		0		7216.7			X			
			3							X			
			4		47		10317.72			X	X		
			5							X			
14:05	0831-003	Harlingen ID (Adams)	1	0	0		49577.5			X			
2									X				
14:15		Harlingen ID	1	50	0		567.6			X			
			2		0		Error			X			
			3		52		3338.7			X	X		
			4		0		1300			X			
			5		0		726.2			X			

Comments:

Harlingen ID Pump 2 has error on totalizer. It is scheduled for repair as per ID employee.

Page

3

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
14:15	0831-003	Harlingen ID	6	50	0		969.50.			X			
			7		0					X			
14:24	0841-005	CCID #2	1	50	0		24709.68			X			
			2							X			
			3							X			
			4							X			
			5		50		306.84			X			
			6							X	X		3
			7							X			
			8							X			
14:43	0838-002	CCID #2 (Paloma)	1	0	0		21662.018			X			
			2		0		966.179			X			
			3		0		0			X			
14:58	0850-000	Lagun Madre WD	1	21	0		664096613			X			
			2		0		224297			X			
			3		22		606146			X	X		

Comments:

Page

4

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/9/2023	Inspections:	33
Time Start:	8:19 AM	Measurement:	4
Time End:	16:40 PM	Doppler:	0
Inspec Time:	4.75	On-Site Notice:	0
RN#:	106122419	Travel Time:	3.25

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:52	0851-000	Rio Grande City	4	4000	3213		5406.33			X			
			5							X	X		
			6							X			
10:30	0699-000	Falcon RWSC	1	900	885		556.8479899			X	X		
			2		0		0			X			
11:04	0727-001	Wesley Vanderool	Ghost T-D							X			
11:08	0679-001	Romualdo Solis	6MF-15				No Pump			X			
11:14	0728-000	Wesley Vanderool	Ghost T-F							X			
11:15	0729-000		6M62-2				No Meter			X			
11:32	0679-001	Romualdo Solis	Ghost T-MF							X			
11:50	0814-000	City of Roma	1	2000	2133		778187.926			X	X		
			2				779761.888			X			
			3							X			
11:59	Tract 1	Ghost Tract 1	Ghost							X			
12:07	Tract 3	Ghost Tract 3	Ghost				County Park			X			
12:22	0618-000	Ruperto B. Escobar	10M16A-2	0	0		794.056			X			
12:25			Ghost T16A							X			
12:52	0641-000	Francisco E. Garcia	10M9	0	0		868.715			X			
13:07	9768-000	Roel Barrera	6M15	0	0		312.044			X			
13:29	0616-000	Jesus Alvarez, Jr.	Ghost T16A							X			
13:33	0663-000	Manuel A. Garza	Ghost T17							X			4
13:34	0682-000	Jose Raul Gonzalez	Ghost T18							X			4
13:50	0631-000	Joel Alvarez	8M21-12				No Meter			X			
14:05	0706-001	Ricardo L. Margo	10M22-6				No Meter			X			
14:06	0767-002	Chapotal Farms	12M30-2				No Meter			X			

Comments:

Page 1 of 2

Specialist Signature

Juan Peña

**Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report**



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/11/2023	Inspections:	39
Time Start:	8:10 AM	Measurement:	6
Time End:	4:15 PM	Doppler:	3
Inspec Time:	5 Hrs.	On-Site Notice:	0
RN#:	106122419	Travel Time:	3 Hrs.

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:42	0851-000	Rio Grande City	4	4000	0		5410.89			X			
			5							X			
			6							X			
9:52	A787-008	Starr Produce	10M32A-8	450	350	252	757.286			X	X		
10:25	0698-000	Marisol Chavez	Ghost T34A							X			
10:27			Ghost T34A							X			
10:28	0719-000	Luis Ernesto Gonzalez	Ghost T35							X			
10:29			6M36-1				Ghost			X			
10:35	0778-000	Faustino Salinas, Jr.	6M34-3	0	0		Digital Off			X			
10:36	0708-000	Adolfo Pena, Jr.	6M34A-4				Ghost			X			
10:50	0851-000	Rio Grande City	1							X			
			2							X			
			3							X			
10:56			Ghost T38B				Boat Ramp			X			
11:04			Ghost T39							X			
11:18			10M40-7				No Meter			X			
11:20	0690-000	Chapotl Farms	Ghost T40A							X			
11:22			10M42-4	0	0		653.174			X			
11:31	0679-002	Vos Farms	6M35-9				No Meter			X			
11:58	0720-000	Chapotal Farms	6M45-9	0	0		689.093			X			
11:59	0777-000	Reavis Farms	8M45-5				No Meter			X			
12:08			10M46-22	1200	1300	1220	300.908			X	X		
12:25			Ghost T43							X			
12:34			Ghost T44							X			
12:40			10M46-20	0	0		287.242			X			

Comments: 0851-000 Reservoir full, will continue pumping later.

Page 1 of 2

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
12:41	0777-000	Reavis Farms	10M46-23	1600	1600	1350	844.725			X	X		
12:54	0232-001	Union Water Supply	1	1000	1076		3920273.25			X			
			2							X	X		
			3							X			
13:03	B711-006	Reavis Farms	Ghost T46							X			
			Ghost T46							X			
13:31	0767-002	Chapotal Farms	10M-53-9	0	0		8802900.027			X			
13:44			10M53-8	0	0		1909.2272			X			
13:45			10M53-11				No Meter			X			
14:34	0863-000	City of La Grulla	1	1100	600		362.998			X	X		
			2		300		501.432			X	X		
14:38	A601-000	Chapotal Farms	10M58-1	0	0		217.86			X			
14:44			6M60-9	0	0		539.171			X			
14:45			6M60-10	0	0		344.058			X			



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/12/2023	Inspections:	42
Time Start:	8:25 AM	Measurement:	7
Time End:	4:25 PM	Doppler:	2
Inspec Time:	5.5 Hrs	On-Site Notice:	1
RN#:	106122450	Travel Time:	2.5 Hrs

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:43	0435-002	Verne Vanderpool	8M66B-6	800	1800	1977	181.166			X	X		
10:13	0638-000		8M79A-4	800	0		729.988			X			
10:29	0758-000		10M64-7	0	0		585.801			X			
10:40	0697-000	Wesley Vanderpool	6M62-6				Ghost			X			
10:44	A/B 126-001	USFWS	6M54				Ghost			X			
10:48			6M78-4	0	0		938.215			X			
10:52			10M68	0	0		219.564			X			
11:01	0571-000	Valley Onions	Ghost T87							X			
11:08	0367-000	Verne Vanderpool	10M61-10	0	0		No Meter			X			
11:09	0367-000	NICO Investments	12M78-5	0	0		61.042			X			
11:11	0367-000	Verne Vanderpool	Ghost T78							X			
11:27	0802-000	HCID #16	1	70	58		15328.54			X	X		
			2		0		16829.06			X			
11:45	0447-000	Sigifredo Garza, Jr.	6M85-9	0	0		No Meter			X			
11:53	0828-001	HCID #6	1	25						X			
			2		0		38873,58			X			
			3		9		10340.64			X	X		
			4		17		5190.22			X	X		
12:07	0492-000	Jose Ramirez, Jr.	6M87-9							X			4
12:10	0816-002	HCID#1	1	45	41		574496063.8			X			
			2							X			
			3							X	X		
			4							X			
			5							X			
			6							X			

Comments:

Certified 8M66B-6 at 10M79A-8 GPS Location; called Mr. Vanderpool in regard to rate. He will adjust rate.
Certified 8M79A at GPS Location of 10M64-7 . Having problems with turtle adjustment. They will start pumping shortly.

Page

1

of

2

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
12:22	0579-00	Richard Vos	10M93-2	0	0		805.05			X			
12:39	0484-000	Wayne Sojak	8M96-2				Ghost			X			
12:45	0530-000	Richard & James Vos	10M100-7	0	0		59.738			X			
			6M100-8	0	0		145.575			X			
12:47	0410-001	Scott Vanderpool	10ME-9				No Meter			X			
12:52	0436-001	Verne Vanderpool	8M92-2	0	0		158.302			X			
12:56	A847-001	United ID	1	100			84391.29			X			
			2		89		11598.66			X	X		
			3				10248.4			X			
13:16	0832-000	HCWC & ID #18	10M112-9	0	0		596.182			X			
			10M112-8	0	0		195.102			X			
13:30	A/B399-000	Neuhaus & Sons	10M115-5	0	0		242.565			X			
			10M115-4	3100	0	3056	830.627			X	X		D
15:06	0806-000	HCWC & ID #19	1	0	0		13585.7			X			
			2		0		7700.4			X			
			3		0		15338.8			X			
			4		0		3217.9			X			

Comments:

Lunch 14:00 - 14:30 (Teams Meeting 14:00 - 15:00)

Page

2

of

2

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/13/2023	Inspections:	67
Time Start:	8:30 AM	Measurement:	8
Time End:	3:50 PM	Doppler:	1
Inspec Time:	5 Hrs	On-Site Notice:	0
RN#:	106122468	Travel Time:	2.25 Hr.

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:36	0524-000	Neuhaus & Sons	Ghost T121A							X			
9:47	A332-000	PPC Farms	8M121	0	0		10.922			X			
9:54	0418-000	Neuhaus & Sons	10M122A-2	0	0		8351.94			X			
10:02	0473-001		8M122-12	0	0		189.549			X			
			8M122-14	0	0		79.508			X			
10:07	0848-000	HCWID #3	1	25			8858.702			X			
			2		24		504.87			X	X		
			3				6674,74			X			
			4		0		61513.6			X			
			5							X			
			6							X			
			7							X			
			Neuhaus		3		2133.71			X	X		
10:32	0808-005	HCWID #2	1	110	0		2433.767			X			
			2		0		8516.297			X			
			3		0		9248.324			X			
			4		54		40667.3			X	X		
			5		0		3063.367			X			
			6		51		6573.013			X	X		
			7		0		33393.739			X			
			8		0		1553.139			X			
			9		0		25352.432			X			
			10		0		15910.072			X			
10:56	0573-001	Dreibelbis Farms	Ghost T129							X			
11:05	A/B 126-001	USFWS	10M134-1				Ghost			X			

Comments:

Page

1

of

3

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
11:12	0401-000	Rio Fresh	8M130A-6				Ghost			X			
11:17	A/B 126-001	USFWS	Ghost T134				Boat Ramp			X			
11:40			10M135A-1	0	0		57.538			X			
11:54	A/B480-000	Frank Schuster Farms	10M135-5	2200	1700		36.679			X	X		
12:01			10M136-9	0	0		974.105			X			
12:06	A/B 480-000	Krenmuller Farms	14M138	1700	1700	2443	24.754			X	X		
12:22			12M138-3	0	0		137.535			X			
12:32	A/B 304-001	Danny E. Arnold	6M145-6	0	0		51.002			X			
12:33			Ghost T145				693.4			X			
12:40	0805-003	Donna ID	1	40	32		1148.288			X	X		
			2		0		0			X			
			3		0		265.7			X			
			4		0		Off			X			
			5		0		0			X			
12:50	A349-000	Tim Reed	12M148-1	0	0		1810.14			X			3
13:03			12M148-2	0	0		320.688			X			
13:08	0317-000	J & D Produce	10M149-3	2400	2600					X	X		
13:13			8M149				Ghost			X			
13:15			Ghost T149							X			
13:16	A/B 126-001	USFWS	10M150	0	0		57.119			X			
13:21	B679-001	Neuhaus & Sons	12M150-8	0	0		718.595			X			
13:24			8M150-9	0	0		316.991			X			
13:33	0420-002		8M151-3				Ghost			X			
13:36			8M152-1				Ghost			X			
13:37	0442-000	Richard B. Drawe	8M153-15	0	0		822.482			X			

Comments:

10M135-5 - Unsafe to doppler (Incline by river). 10M149-3 - Unsafe to doppler (in Pit). 8M151-3 & 8M152-1 Ghost, fenced with razor wire.

Page 2 of 3

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
13:40	A/B 301-000	Estate of William H. Drawe	8M153-14	0	0		644.526			X			
13:43	0381-001	Hans O. Hovda	12M153-12	0	0		498.271			X			
13:45	0506-000	Danny Arnold	12M153-3	0	0		3317.65			X			
13:46			6M154-4	0	0		177.154			X			
13:47			0318-000	10M154-1				Ghost			X		
13:54	0381-001	Hans O. Hovda	12M155-3	0	0		421.926			X			
13:55	0565-000		10M156-22	0	0		397.092			X			
13:59			10M156-15	0	0		116.906			X			
13:01			10M156-21	0	0		No Meter			X			
14:06	T-157	Ghost Tract 157	Ghost							X			
14:07	0351-000	Troy Bradford	10M157	0	0		995.997			X			
14:08			Ghost T158				Boat Ramp			X			
14:09			Ghost T158							X			
14:26	A813-000	HCID #5	1	0	0		4449.99			X			
			2		0		1513.04			X			
			3		0		1745.6			X			
			4		0		2839.68			X			

Comments:

Lunch 14:35 - 15:05

Page

3

of

3

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/17/2023	Inspections:	40
Time Start:	8:27 AM	Measurement:	9
Time End:	4:20 PM	Doppler:	2
Inspec Time:	5.25 Hrs.	On-Site Notice:	0
RN#:	106122450	Travel Time:	2.75 Hrs

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:50	0863-000	City of La Grulla	1	1100	600		375.827			X	X		
			2		350		506.77			X	X		
9:56	A601-000	Chapotal Farms	10M58-1	0	0		217.86			X			
10:03			6M60-9	0	0		539.171			X			
10:04			6M60-10	0	0		344.058			X			
10:21	0636-001	Verne Vanderpool	8M66B-6	800	875	1056	206.068			X	X		
10:39	0758-000		10M64-7	0	0		733.47			X			
10:44	0638-000		8M79A-4	0	0		585.801			X			
10:54	0697-000	Wesley Vanderpool	6M62-6				Ghost			X			
11:00	A/B 126-001	USFWS	6M54				Ghost			X			
11:04			6M78-4	0	0		938.215			X			
11:07			10M68	0	0		219.564			X			
11:15	0571-000	Valley Onions, Inc.	Ghost T87							X			
11:20	0367-000	NICO Investments	12M78-5	0	0		65.723			X			
11:21	0367-001	Verne Vanderpool	10M61-10				Pumping No Meter			X			
11:55	0367-000	Verne Vanderpool	Ghost T78							X			
12:09	0802-000	HCID #16	1	70	0		16925.98			X			
			2		68		15958.01			X	X		
12:39	0447-000	Sigifredo Garza, Jr.	6M85-9	0	0		No Meter			X			
12:47	0828-001	HCID #6	1	27						X			
			2				38873.58			X			
			3		10		10393.54			X	X		
			4				5221.09			X			
13:05	0492-000	Jose Ramirez, Jr.	6M87-9							X			4
13:10	0816-002	HCID #1	1	125	132		12826.875			X			

Comments:	Certified 8M66B-6 at 10M79A-8 GPS location. 10M61-10 - called Gina, she visited with Mr. Vanderpool. HCID #6 contacted district on rate.	Page	1	of	2	Specialist Signature	<i>Juan Peña</i>



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
13:10	0816-002	HCID #1	2	125	132		12826.875			X			
			3							X			
			4							X	X		
			5							X			
			6							X			
13:50	0579-000	Richard Vos	10M93-2	0	0		59.738			X			
14:05	0484-000	Wayne Sojak	8M96-2				Ghost			X			
14:10	0530-002	Joe Metz	10M100-7	0	0		59.738			X			
14:11			6M100-8	0	1400	1518	147.092			X	X		
14:35	0410-001	Scott Vanderpool	10ME-9	800	800		517.213			X	X		
14:51	0436-00	Verne Vanderpool	8M95-2	0	0		158.302			X			
14:52	T-95	MP-10 Pumping	MP-10							X			5
15:10	A847-001	United ID	1	100	0		84391.28			X			
			2		90		12091.07			X	X		
			3		0		10248.4			X			

Comments:

Lunch - 13:20 - 13:50; 6M100-8 - 0530-002 - No OSN issued, verified with Watermaster of customer certification. 10ME-9 very muddy to doppler.

Page 2 of 2

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/18/2023	Inspections:	60
Time Start:	8:30 AM	Measurement:	9
Time End:	4:20 PM	Doppler:	1
Inspec Time:	6 Hrs.	On-Site Notice:	0
RN#:	106122450	Travel Time:	2 Hrs.

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:38	A847-001	United ID	1	100	0		84391.28			X			
			2		92		12228.64			X	X		
			3		0		10248.4			X			
9:55	0453-000	Griffan & Brand McAllen	8M108A-10				Ghost			X			
10:12	A/B 126-001	USFWS	10M112-2	0	0		68580			X			
10:27	0832-000	HCWC & ID#18	10M112-9	0	0		596182			X			
			10M112-8	0	0		95.102			X			
10:45	A/B 399-000	Neuhaus & Sons	10M115-5							X			4
			10M115-4							X			4
10:56	0806-000	HCWC & ID#19	1	0	0		13585.7			X			
			2		0		7700.4			X			
			3		0		15338.8			X			
			4		0		3217.9			X			
11:18	0848-000	HCWID #3	1	25	0		8858.702			X			
			2		23		744.34			X	X		
			3		0		6674.74			X			
			4		0		6151.36			X			
			5		0					X			
			6		0					X			
			7		0					X			
			Neuhaus		5		2147.86			X	X		
11:24	0473-001	Neuhaus & Sons	8M122-14	0	0		79.508			X			
11:25			8M122-12	0	0		189.549			X			
11:33			10M122A-2	0	0		8351.94			X			
11:37			Ghost T-121A				TP Site			X			



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
11:41	A332-000	PPC Farms	8M121A	0	0		109.22			X			
12:05	0808-005	HCWID #2	1	110	0		2433.767			X			
			2		0		8516.297			X			
			3		0		9248.324			X			
			4		55		41226.173			X	X		
			5		0		3063.367			X			
			6		53		7071.73			X	X		
			7		0		333956.87			X			
			8		0		1553.278			X			
			9		0		25352.432			X			
			10		0		15945.276			X			
12:32	0573-001	Dreibelbis Farms	Ghost T129							X			
12:41	A/B126-001	USFWS	10M134-1				Ghost			X			
12:47	0401-000	Rio Fresh Inc.	8M130A-6				Ghost			X			
12:52	A/B126-001	USFWS	Ghost T134							X			
13:09			10M135A-1	0	0		57.538			X			
13:50	A/B554-000	Frank Schuster Farms	10M135-5	2200	1450		79.125			X	X		
14:14			10M136-9	0	0		974.105			X			
14:19	A/B480-000	Krenmuller Farms	14M138	1700	1700	2400	64.419			X	X		
14:33			12M138-3	0	0		137.535			X			
14:41	A/B304-001	Danny E. Arnold	6M145-6	0	0		51.002			X			
14:42			Ghost T145							X			
14:47	0805-003	Donna ID	1	40	42		1591			X	X		
			2		0		0			X			
			3		0		265.7			X			

Comments:

Lunch 13:20 -13:45 10M135-5 unsafe to doppler (pump on incline on river's edge)

2

of

3

Specialist Signature

Juan Peña



On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Comments: Pump 10M149-3 in pit, unable to doppler. Page 3 of 3 Specialist Signature *Juan Peña*



Texas Commission on Environmental Quality

Rio Grande Watermaster

Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date: 1/19/2023

Inspections: 93

Time Start: 8:25 AM

Measurement: 10

Time End: 4:05 PM

Doppler: 4

Inspection Time: 6.25

On-Site Notice: 0

RN#: 106122468

Travel Time: 1.25

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:10	A/B480-000	Krenmuller Farms	14M138	0	0		69.831			x			3
9:12			12M138-3	0	0		137.535			x			
9:22	A/B304-001	Danny E. Arnold	6M145-6	0	0		51.002			x			
9:23			6M145-7	0	0		593.48			x			
9:31	0805-003	Donna ID	1	40	42		1558.96			x	x		
			2		0		0			x			
			3		0		265.7			x			
			4		0		Off			x			
			5		0		0			x			
9:40	A349-000	Tim Reed	12M148-1	0	0		181.014			x			
9:44			12M148-2	0	0		320.688			x			
9:47	0317-000	J & D Produce	10M149-3	2400	2600		564.355			x	x		
9:52			8M149				Ghost			x			
9:54			Ghost T149							x			
9:56	A/B126-001	USFWS	10M150	0	0		57.119			x			
10:02	B679-001	Neuhaus & Sons	8M150-8	0	0		718.596			x			
10:04			8M150-9	0	0		316.991			x			
10:12	0420-002		8M151-3				Ghost			x			
10:18			8M152-1				Ghost			x			
10:20	0442-000	Richard B. Drawe	8M153-15	0	0		822.482			x			
10:25	A/B301-000	Estate of William H. Drawe	8M153-14	0	0		644.526			x			
10:26	0381-001	Hans O. Hovda	12M153-12	0	0		4982.79			x			
10:30	0506-000	Danny E. Arnold	12M153-3	0	0		3317.65			x			
10:31			6M154-4	1900	2000	2400	226.886			x	x		
10:43	0318-000			10M154-1				Ghost			x		

Comments:

10M149-3 unsafe to doppler (Pit). 8M151-3 and 8M152-1 Ghost sites, razor wire fence.

Page

1

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
10:45	0381-001	Hans O. Hovda	12M155-3	0	0		4219.23			X			
10:47	0565-000		10M156-22	0	0		397.092			X			
10:50			10M156-15	0	0		116.906			X			
10:51			10M156-21				Ghost			X			
10:55	T157	Ghost Tract 157	Ghost						X				
10:56	0351-000	Troy Bradford	10M157	0	0		995993			X			
10:57			Ghost T158				Boat Ramp			X			
10:59			Ghost T158						X				
11:08	813-000	HCID #5	1	0	0		4449.99			X			
			2		0		1513.04			X			
			3		0		1745.6			X			
			4		0		2839.68			X			
11:34			3M160-11	0	0		No Meter			X			
11:36	0422-000	Benton Beckwith	10M160-10	0	0		No Meter			X			
11:37			10M160-9	0	0		805.286			X			
11:42			10M160-12	2000	1150	1244	828.027			X	X		
12:09	0434-000	B & B Farms	10M161-4	0	0		354.159			X			
12:13			10M160-8	0	0		102.16			X			
12:16			8M165-4	0	0		603.799			X			
12:17			8M166-6	0	0		654.065			X			
12:19			10M166-4	0	0		Ghost			X			
12:28	0502-000	Beckwith Farms	8M167	0	0		739.03			X			
12:38	0812-007	H & CCID #9	1	120	0		40072060.95			X			
			2		0		18003.514			X			
			3		0		68755.046			X			

Comments:

Specialist Signature

Juan Peña



**Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report**

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
12:38	0812-007	H & CCID #9	4	120	0		13326.127			X			
			5		0		14169.921			X			
			6		56		854163.43			X	X		
			7		59		42661.435			X	X		
			8		0		35684.734			X			
			9		0		2062.913			X			
			10		0		1135.147			X			
13:28	0345-000	Neuhaus & Sons	6M168-6	0	0		389.61			X			
13:30	0811-002	Delta Lake ID	1	160	166		85723.147			X			
			2							X	X		
			3							X			
			4							X			
13:33	A/B304-001	Danny Arnold	6M170-2	0	0		529.712			X			
13:39			Ghost T172							X			
13:41			6M171-11	0	0		243.637			X			
13:45			6M172-9				Ghost			X			
13:50			6M145-7	1250	1550	900	516.584			X	X		
13:51			10M172-12	0	0		1788.4082			X			
14:17	083-005	La Feria ID (Santa Maria)	1	0	0		3458.84			X			
			2		0		6331.8			X			
			3		0		2461.47			X			
14:26	0189-000	Zachary T. McLemore	Ghost T174							X			
14:27			6M171-1	0	0		341.848			X			
14:28			8M174-1	0	0		646.074			X			
14:35	083-005	La Feria ID	1	40	0		51338.9			X			

Comments:

Lunch 13:00 - 13:25 6M145-7 confirmed with Gina.

Page

3

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
14:35	083-005	La Feria ID	2	40	0		7216.7			X			
			3						X				
			4		43	103274.6			X	X			
			5						X				
14:39	0287-000	Donald F. Phillipp	Ghost T176						X				
14:42	0063-000		Ghost T181						X				
14:46			Ghost T184						X				
14:50	A/B126-001	USFWS	12M185-1	0	0		No Meter			X			
14:52			12M188-5	0	0		6140.1			X			
14:54	0244-000	Abraham Castillo	12M186-2	1400	1100	980	659.17			X	X		
15:07	0244-000	James Bauer	Ghost T186							X			
15:09	0025-000	Zachary T McLemore	12M185-2	0	0		288.484			X			
15:11	0087-000	Victoria Farms	Ghost T190							X			
15:13	0831-003	Harlingen ID (Adams)	1	0	0		495.775			X			
			2		0					X			
15:18	A/B213-000	Sam R. Sparks	12M192-1	0	0		No Meter			X			
15:20			Ghost T192						X				
15:26			12M192-17	0	0		606204			X			

Comments:

12M192-1 Steel Pipe is being replaced - No meter at this time.

Page

4

of

4

Specialist Signature



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date:	1/23/2023	Inspections:	100
Time Start:	8:30 AM	Measurement:	5
Time End:	4:10 PM	Doppler:	0
Inspec Time:	6.25	On-Site Notice:	0
RN#:	106122526	Travel Time:	1.25 Hrs.

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:15		Brownsville Gaging Station							1.3	X			
9:29	A843-000	Brownsville ID	1	0	0		6264			X			
			2							X			
			3							X			
			4							X			
9:49	T307	Ghost T307	Ghost							X			
9:58	M865-000	Brownsville PUB	Ghost T298							X			
10:08	0010-002	Edward Mathers Farms	Ghost T297				Boat Ramp			X			
10:10			Ghost T297							X			
10:13			Ghost T297							X			
10:14			Ghost T297							X			
10:17	M865-000	Brownsville PUB	1	30	30		21922			X	X		
			2		0		2076			X			
10:27	0123-001	Edward Mathers	Ghost T292							X			
10:35	A/B126-001	USFWS	Ghost T294							X			
10:36	0159-000	Edward Mathers	Ghost T290							X			
10:41			Ghost T290							X			
10:42			Ghost T289							X			
10:43	0135-000	Edward Mathers Farms	Ghost T284							X			
10:49			Ghost T284							X			
10:52			Ghost T284							X			
11:04	0829-000	CCID #6	1	0	0		290285537			X			
			2							X			
			3							X			
			4							X			

Comments:

Page 1 of 4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
11:04	0829-000	CCID #6	5	0	0		290285537			X			
			6							X			
			7							X			
11:12	0072-002	VMUD #2	1	0	0		0.0005			X			
			2		0		129.3878			X			
			3		0		2089.0819			X			
11:25	0130-000	Edward Mathers	Ghost T279							X			
11:27	Tract 279	Ghost Tract 279	Ghost							X			
11:28	0072-008	Manuel Ortiz	14M278-7	0	0		428.483			X			
11:30	0167-000	Victoria Farms	Ghost T275				Boat Ramp			X			
11:34	0295-000	Teofilo Flores, Jr.	Ghost T274							X			
11:36	0288-000	Russell Plantation	1	0	0		No Meter			X			
			2							X			
11:41	0243-001	Victoria Farms	Ghost T273							X			
11:42			Ghost T273							X			
11:44	0059-000	Juan F. Leal	Ghost T272							X			
11:45			Ghost T272							X			
11:47	0130-000	Victoria Farms	Ghost T272							X			
11:49	0114-001	Abel & Lidia Longoria	Ghost T270							X			
11:51	0080-001	Juan F. Leal	10M269-11	0	0		No Meter			X			
11:52	0040-000		Ghost T269							X			
11:57	0292-000		10M264	0	0		No Meter			X			
12:00	Tract 269	Ghost Tract 261	Ghost							X			
12:08	Tract 260	Ghost Tract 260	Ghost							X			
12:10	0206-000	Juan F. Leal	Ghost T258							X			

Comments:

Page

2

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
12:14	0206-000	Juan F. Leal	Ghost T258							X			
12:20	0091-000		10M257-2	0	0		Unreadable Meter			X			
12:24	0850-000	Laguna Madre WD	1	10323	8580		674730498			X			
			2		9950		252118			X	X		
			3		0		626643			X			
12:51	0056-000	Juan F. Leal	Ghost T248						X				
12:56	0066-000		Ghost T242						X				
12:57			Ghost T242						X				
12:58	A/B126-001	USFWS	Ghost T240A							X			
13:02	Tract 240A	Ghost Tract 240A	Ghost							X			
13:06	0097-000	Argintina G. Garcia	12M256				Ghost			X			
13:11	0838-002	CCID #2 (Paloma)	1	0	0		21662.018			X			
			2		0		966.179			X			
			3		0		0			X			
13:43	0066-000	Juan F. Leal	Ghost T230							X			
13:44			Ghost T230							X			
13:51	0100-000	Argintina G. Garcia	Ghost T230							X			
14:03	Tract 223	Ghost Tract 223	Ghost							X			
14:12	0220-000	Wells Brothers	12M221-3	0	0		201.561			X			
14:19	0290-000	Abraham Castillo	Ghost T220							X			
14:22	0296-003	Chris Bauer	Ghost T220							X			
14:30	0089-000	Zachary T. McLemore	14M214-6	0	0		717.275			X			
14:36	Tract 212	Ghost Tract 212	Ghost							X			
14:38	0101-002	Victoria Farms	Ghost T210							X			
14:41	Tract 206	Ghost Tract 206	Ghost							X			

Comments: 10M257-2 leather strap wrapped around meter face. Laguna Madre pump 1 is registering flow, but pump is off. I called Rafael, he was going to contact district. Lunch 13:15 - 13:40

Page 3 of 4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
14:42	Tract 206	Ghost Tract 206	Ghost							X			
14:44		San Benito Gaging Station						0.7		X			
14:58	0263-001	Nicolas Palacios, Jr	Ghost T205							X			
15:01			Ghost T204							X			
15:02	0130-000	Victoria Farms	Ghost T201							X			
15:03			Ghost T201							X			
15:04			Ghost T201							X			
15:06	0052-000	Arnoldo George	Ghost T200							X			
15:07	A/B126-000	USFWS	Ghost T200							X			
15:08	0841-005	CCIC #2	Ghost T200	100	55		25265.73			X			
15:18			1							X			
			2							X	X		
			3							X			
			4							X			
			5		53		1281.17			X			
			6							X	X		
			7							X			
			8							X			
15:35	0831-003	Harlingen ID	1	80	0		1006.7			X			
			2		75		45.6			X	X		
			3		0		3898.1			X			
			4		0		1380			X			
			5		0		726.2			X			
			6		0		969.5			X			
			7							X			

Comments:

Harlingen ID totalizer for pump 2 meter has been repaired.

Page

4

of

4

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality

Rio Grande Watermaster

Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Date: 1/25/2023

Inspections: 111

Time Start: 8:25 AM

Measurement: 9

Time End: 4:08 PM

Doppler: 0

Inspection Time: 6.5 Hrs.

On-Site Notice: 0

RN#: 106122468

Travel Time: 1.25 Hr

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
9:04	0813-000	HCID #5	1	20	0		4449.99			X			
			2		3		1637.57			X	X		
			3		0		1745.6			X			
			4		0		2839.68			X			
9:14			3M160-11				No Meter			X			
9:30	0422-000	Benton Beckwith	10M160-10	0	0		No Meter			X			
9:33			10M160-9	0	0		805.288			X			
9:38			10M160-12	0	0		830.804			X			
9:41	0434-000	B & B Farms	10M161-4	0	0		354.156			X			
9:44			10M160-8	0	0		102.16			X			
9:48			8M165-4	0	0		603.799			X			
9:50			8M166-6	0	0		654.065			X			
9:52			10M166-4	0	0		Ghost			X			
10:00	0502-000	Beckwith Farms	8M167	0	0		739.03			X			
10:08	0812-007	H & CCID #9	1	60	0		40072060.95			X			
			2		0		18003.514			X			
			3		0		68755.621			X			
			4		0		13326.127			X			
			5		0		14170.248			X			
			6		52		854812.688			X	X		
			7		0		43215.719			X			
			8		0		35684.735			X			
			9		0		2062.913			X			
			10		0		1135.147			X			
10:24	0345-000	Neuhaus & Sons	8M167	0	0		389.61			X			

Comments:

HCID #5 - ID Men working on pumps.

Page

1

of

5

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
10:28	0811-002	Delta Lake ID	1	250	249		87845.319			X			
			2						X	X			
			3						X				
			4						X				
10:31	A/B304-001	Danny E. Arnold	6M170-2	0	0		529.712			X			
10:38			Ghost T172							X			
10:41			6M172-11	0	0		243.637			X			
10:47			Ghost T172							X			
10:50			6M145-7	0	0		521.266			X			
			10M172-12	0	0		1788.408			X			
10:58	0803-005	La Feria ID (Santa Maria)	1	0	0		3458.84			X			
			2	0	0		6331.8			X			
			3	0	0		2461.47			X			
11:03	0189-000	Zachary T. McLemore	Ghost T174						X				
11:04			6M171-1	0	0		341.848			X			
11:07			8M174-1	0	0		646.074			X			
11:12	0803-005	La Feria ID	1	40	0		51338.1			X			
			2				7216.7			X			
			3						X				
			4		45		103686.1			X	X		
			5						X				
11:20	0287-000	Donald F. Phillipp	Ghost T176						X				
11:25	0063-000		Ghost T181						X				
11:28			Ghost T184						X				
11:34	A/B126-001	USFWS	12M185-1				Ghost			X			

Comments:

La Feria ID - I visited with Rafael on flow rate.

Page

2

of

5

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
11:38	A/B 126-001	USFWS	12M188-5	0	0		6140.13			X			
11:42	0177-000	Abraham Castillo	8M186-2	0	0		966.557			X			
11:47	0244-000	James Bauer	Ghost T186							X			
11:49	0025-000	Zachary T. McLemore	12M185-2	0	0		288,484			X			
11:53	0087-000	Victoria Farms	Ghost T190							X			
11:56	0831-003	Harlingen ID (Adams)	1	35	38		49728.7			X	X		
			2							X			
11:59	A/B213-000	Sam R. Sparks	12M192-1	0	0		4038.08			X			3
12:03			Ghost T192							X			
12:10			10M192-17	0	0		606204			X			3
12:16			10M192-16	0	0		156.448			X			3
12:24			Ghost T194							X			
12:31	0198-000	Raul Palma	Ghost T197							X			
12:40	0831-003	Harlingen ID	1	80	0		1006.7			X			
			2		75		318.8			X	X		
			3		0		3998.1			X			
			4		0		1380			X			
			5		0		726.2			X			
			6		0		969.5			X			
			7		0					X			
13:20	0841-000	CCID #2	1	100	55		25435.75			X			
			2							X	X		
			3							X			
			4							X			
			5							X			

Comments:

12M192-1 - A new 15" steel pipe was installed. Lunch 12:45 - 13:15

Page

3

of

5

Specialist Signature

Juan Peña



Texas Commission on Environmental Quality
Rio Grande Watermaster
Deputy's Daily Report

Site Code: 1 = ID New Pump ; 2 = No Doppler Reading ; 3 = Meter Diagram ; 4 = No Access ; 5 = MX Pump

On-Site Notice Codes: A = No Note/Cert Posted ; B = No Certification ; C = No Meter ; D = Inoperable Meter ; E = +/- 10% ; F=Hazard

Time	Adjudication #	Diverter Name	Pump #	Cert Rate	Meter Rate	Doppler Rate	Totalizer	IBWC Gage		I	M	N	Code
								SB	BR				
13:20	0841-000	CCID #2	6	100	40		1459.6			X			
			7							X	X		
			8							X			
13:33	0841-005		Ghost T200							X			
13:36	A/B126-000	USFWS	Ghost T200							X			
13:37	0052-000	Arnoldo George	Ghost T200							X			
13:40	0130-000	Victoria Farms	Ghost T201							X			
13:41			Ghost T201							X			
13:42			Ghost T201							X			
13:43	0263-001	Nicolas Palacios, Jr.	Ghost T204							X			
13:46			Ghost T205							X			
13:54		San Benito Gaging Station						0.6		X			
14:01	Tract 206	Ghost Tract 206	Ghost							X			
14:02	Tract 206	Ghost Tract 206	Ghost							X			
14:05	0101-002	Victoria Farms	Ghost T210							X			
14:07	Tract 212	Ghost Tract 212	Ghost							X			
14:11	0089-000	Zachary T. McLemore	14M214-6	0	0		717.275			X			
14:21	0296-000	Chris Bauer	Ghost T220							X			
14:22	0290-000	Abraham Castillo	Ghost T220							X			
14:26	0222-000	Wells Brothers	12M221-3	0	0		201.561			X			
14:38	Tract 223	Ghost Tract 223	Ghost							X			
14:52	0100-000	Argentina G. Garcia	Ghost T230							X			
14:55	0066-000	Juan F. Leal	Ghost T230							X			
14:56			Ghost T230							X			
15:00	0838-002	CCID #2 (Paloma)	1	0	0		21662.018			X			

Comments:

Specialist Signature

Juan Peña

